Service Information



Subject: VAS5581A Technical Product Service Information UPDATED Oct 10, 2024 to include Battery replacement Number: ATE-24-12

Date: Sept. 25, 2024

This communication provides important information on the High Voltage Diagnostics Box VAS5581A.

The VAS5581A has an internal battery that must stay charged. Keep the provided charger always plugged into the VAS5581A and a wall outlet.



*NOTE: DO NOT open the VAS5581A to replace the batteries if still under warranty, please contact the Audi Tools and Equipment program at 800-892-9650

© 2024 Audi of America, Inc.


Page 1 of 2

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to Publicither sites, without the prior expressed written permission of the publisher

Battery Replacement (in case of not powering up and not charging):

If the VAS5581A is no longer under warranty the 6 internal batteries can be replaced with <mark>Samsung25R</mark> <mark>3.7V Rechargeable 18650 Battery 25R Flat Top, Real 2500mAh</mark>.

After removing the 6 torques that are securing the back casing of the tool you will have access to the batteries. <u>Please note direction of the orientation prior to removing the batteries</u>.

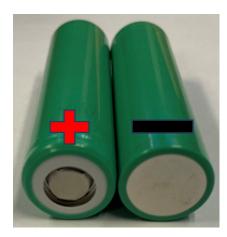



After installing the new batteries and securing the rear casing, make sure to check the red stop button on the front, as it may have been pressed while the tool was turned over during maintenance.

© 2024 Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to Publiother sites, without the prior expressed written permission of the publisher.